

Manhole Inspection Summary

Manhole # S29AA2011MH

Printed On: 12/17/2008

Page 1 of 4

Inspection ☐ Is Incomplete Rating: **4) Poor**

Record Plat: **29AA2** Node: **011** Status: **Found**

Insp Date: **4/17/07 11:28 AM**

Incomplete Comments

Crew: **JY, JC**
Inspector: **Yi, J**
Firm: **RKK**

Location Address: **5405 CHARLES ST**

Cross Street: **NORTHERN PKWY**

Manhole Type: **Junction**

Location: **Sidewalk**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments **The I9 Drop ext. picture shows Barrel and Channel deterioration.**

Cover

Shape: **Circular**

Diameter: **24** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame

Offset: **0** (in.)

Condition: ☐ Sound

☐ Cracked

☒ **Leaks**

Chimney / Frame Adjustment

☒ Exists Material: **Brick**

☐ Parged Height: **17** (in.)

Condition: ☐ Sound

☐ Cracked

☐ Root Intrusion

☒ **Loose Brick**

☒ **Deteriorated**

Infiltration: ☐ None

☒ **Joint**

☐ Cracks

☒ **Mortar**

☐ Roots

☐ Wall

Corbel

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound

☐ Cracked

☐ Root Intrusion

☐ Loose Brick

☐ Deteriorated

Infiltration: ☐ None

☐ Joint

☐ Cracks

☒ **Mortar**

☐ Roots

☒ **Wall**

Barrel

Material: **Brick**

☐ Parged

Shape: **Circular**

Diameter: **42** (in.) Length: (in.)

Condition: ☐ Sound

☐ Cracked

☐ Root Intrusion

☐ Loose Brick

☒ **Deteriorated**

Infiltration: ☐ None

☐ Joint

☐ Cracks

☒ **Mortar**

☐ Roots

☐ Wall

Bench

☒ Exists Material: **Brick**

☐ Parged

☐ Debris (not Condition related)

Condition: ☐ Sound

☐ Cracked

☐ Root Intrusion

☒ **Deteriorated**

☐ Leaks

☐ Debris

Channel

Material: **Brick**

☐ Parged

☐ Debris (not Condition related)

Channel Exposure: **Fully Open**

Junc Dist: **0**

nearest .5 ft. Azimuth:

Condition: ☐ Sound

☐ Cracked

☐ Root Intrusion

☒ **Deteriorated**

☐ Leaks

☐ Debris

Steps

Count: **6**

Missing: **0**

☒ **Corroded**

Surcharge

☐ Evidence Of Surcharge

Depth:

(ft.)

☐ Active Surcharge Present

Manhole Inspection Summary

Manhole # S29AA2011MH

Printed On: 12/17/2008

Page 2 of 4

Location View



Top View



Barrel infiltration. Bench debris. Corroded steps.

Defect



Frame leaks. Adjustment deterioration, loose brick and infiltration. Corbel infiltration.


Manhole Inspection Summary

Manhole # S29AA2011MH

Printed On: 12/17/2008

Page 3 of 4

8 in. Circular Gravity Sewer Pipe Out @ 12 O'Clock

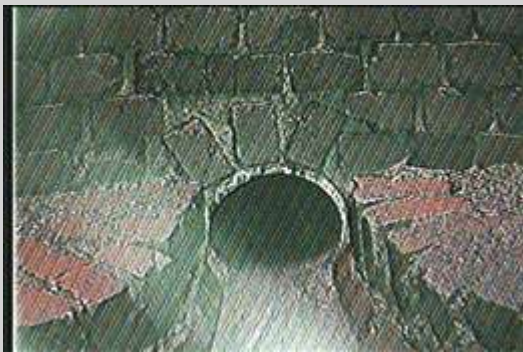

Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **12.01** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Evidence** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer Pipe In @ 3 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **6.99** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop In @ 3 O'Clock



Barrel deterioration and infiltration. Bench and Channel deterioration.

Drop: **Outside** Rod and Bar

Angled: **Yes** Reading: **10.92** (ft.)

Inv Depth: **11.92** (ft.)

Drop Condition: **Open**

Connects To: **Manhole**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S29AA2011MH

Printed On: 12/17/2008

Page 4 of 4

6 in. Circular Gravity Sewer

Pipe In @ 6 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay**

☐ Pipe Lined

Invert Depth: **11.89** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None**

Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **House connection / Service line**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer

Pipe In @ 9 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay**

☐ Pipe Lined

Invert Depth: **7.18** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Evidence**

Pipe Seal Cond: **Unknown**

Drop In @ 9 O'Clock



Barrel deterioration and infiltration. Bench and Channel deterioration.

Drop: **Outside** Rod and Bar

Angled: **Yes**

Reading: **10.89** (ft.)

Inv Depth: **11.89** (ft.)

Drop Condition: **Open**

Connects To: **Manhole**

☐ Possible Illicit Connection